

Geonautics Windows XP Driver Installation Procedure Document

Project Name:	Geonautics USB Dongles
Document Title:	Windows XP Driver Installation Procedure
Creation Date:	27-June-2003
Revision:	27-June-2003
Project Company:	Geonautics

Contents

Contents	i
List of Figures	i
1. Driver Installation Procedure	2

List of Figures

Figure 1.1. Wizard Opening Screen	2
Figure 1.2. Wizard Logo Testing Warning Window	3
Figure 1.3. Wizard Copy and Install Progress	3
Figure 1.4. Wizard Completion Screen.....	4

1. Driver Installation Procedure

1. Place the Whisper installation CD in the computers' CD-ROM drive. Cancel the Whisper program auto-install if the Whisper software has already been installed.
2. Plug the USB cable into the computer. The 'Add New Hardware Wizard' should be activated which is searching for 'Geonautics Dongle I'.



Figure 1.1. Wizard Opening Screen

3. Select the 'Install the software automatically (Recommended)' option and press the 'Next' button.

A new window will open, which searches for the Geonautics Dongle I driver. Once the Wizard finds the driver it will attempt to install it. During the installation a window stating that 'The software you are installing for this hardware has not passed windows Logo testing to verify its compatibility with Windows XP' may be encountered (see figure 1.2.) If so, press the 'Continue Anyway' button.



Figure 1.2. Wizard Logo Testing Warning Window

4. Once the Wizard finds the drivers, it will copy and install the necessary files from the CD-ROM (See Figure 2.3.)

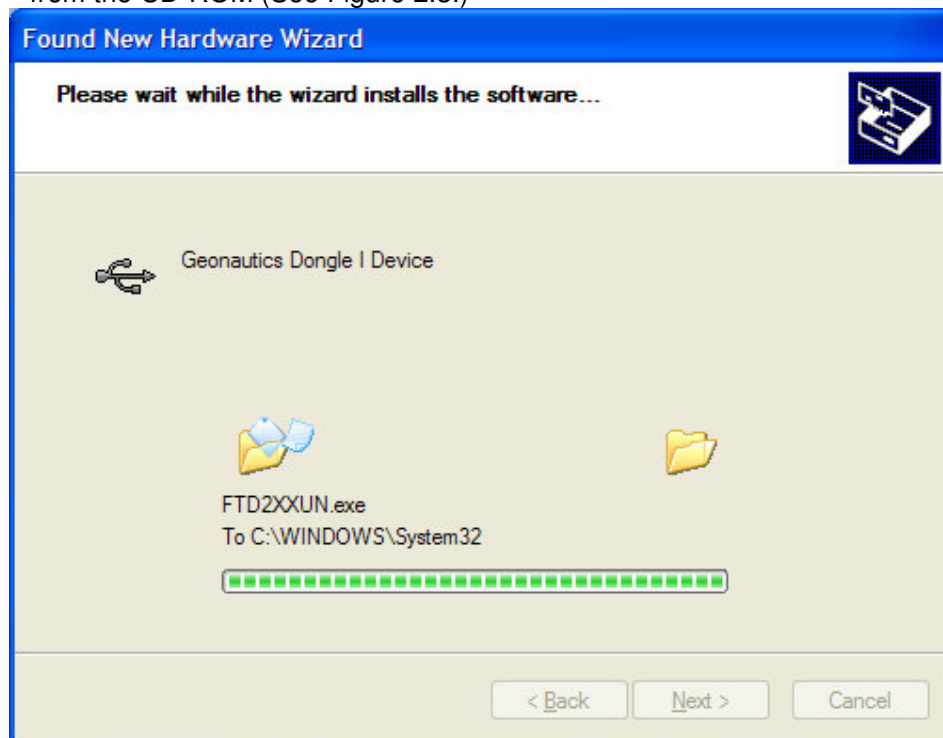


Figure 1.3. Wizard Copy and Install Progress

5. A final dialog box should be displayed with 'Geonautics Dongle I Device' clearly written at the top of the dialog. The dialog should state that 'Windows has finished installing the software for: Geonautics Dongle I Device'.

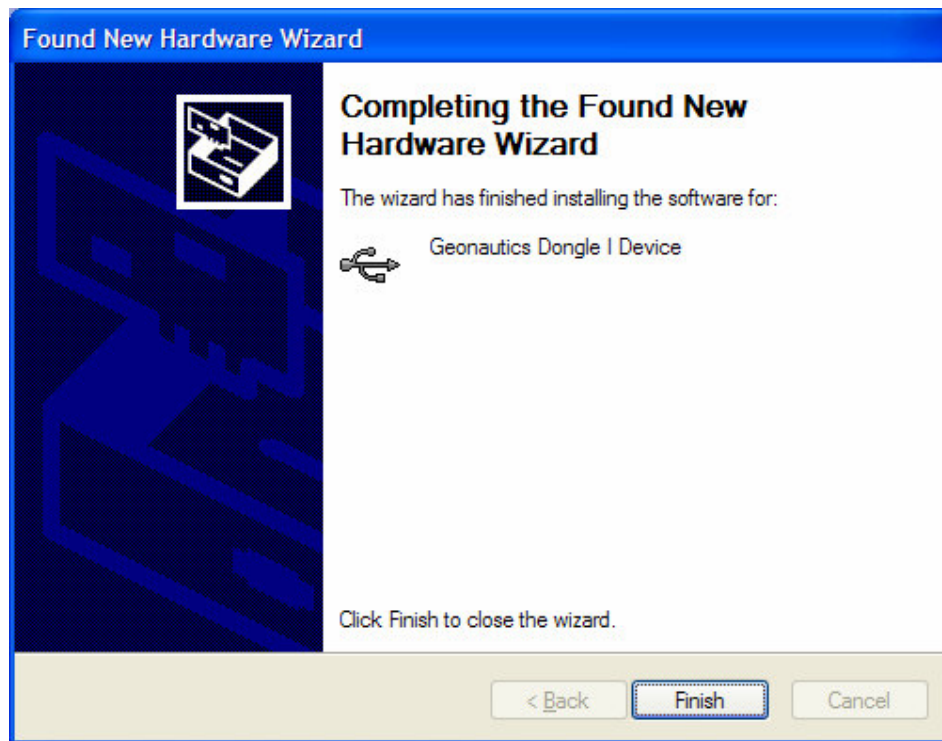


Figure 1.4. Wizard Completion Screen

6. Press the 'Finish' button. The appropriate USB driver should now be installed.